EAR:	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
DATE				
				Bearhawk S/N: 030-53/54-704 N1685 08/16/23 HOBBS: 517.7 TTIS: 517.7 Performed condition inspection on airframe. Cleaned, inspected and packed wheel bearings. Inspected ELT IAW FAR 91.207d and C.W. AD 2017-16-01 on AK-450 and 451 ELTs. Batteries good until July 2024. Removed and replaced several stripped screws from wing panels. Bled left hand brake and serviced. Serviced left and right hand landing gear struts. Installed new 1140 Scott Type rudder arm, P/N U1140Q-000 on rudder. I certify this aircraft has been inspected IAW a conditional inspection and was found to be in a condtion for safe operation at this time.
				10/4/23 Replaced Scott tail wheel suspension with 52h; T3 Tail wheel suspensions from ABI, LLC Chapter 3582717
				52h; T3 Tail Wheel suspensions from ADI, LCC